

marantz SERVICE BULLETIN <small>SS-MAR0234</small>	model number 250	bulletin number M-250-4
	for serial numbers Above 6549	
	subject SERVICE BULLETIN CORRECTION	
	engineering approval <i>H. Almeida</i>	date 9-24-76

This Service Bulletin is issued to correct an error in Marantz Service Bulletin M-250-3, dated August 16, 1976.

On Page 6 of Service Bulletin M-250-3, make the underlined changes;

BIAS ADJUSTMENT

Bias adjustment must be made when the unit is cold and then retouched if necessary after a minimum ½ hour warm up period.

- a. Preset the bias adjustment potentiometer R526 on each amplifier board fully CCW.
- b. Connect a voltmeter across the series combination of R531 and R532 of the Left Channel, (voltmeter set to 0-100 mV range).
- c. Adjust the Left Channel bias adjustment potentiometer R526 for a voltmeter reading of between 12 and 15 mV.
- d. Repeat above procedure for Right Channel.

Almeida
 Albert Almeida, Manager
 Technical Services