SANSUI ELECTRIC COMPANY LIMITED/14-1, 2-CHOME, IZUMI, SUGINAMI-KU, TOKYO, JAPAN/TELEPHONE: 323-1111/CABLE: SANSUIELEC TOKYO/TELEX: 232-2076

Sansui SERVICE BULLETIN

June 1, 1970
Ref. CE-013

Subject: MODIFICATION OF THE POWER CIRCUIT
Model: 2000A

1. If noise (input shorted) is noticeable in the power amplifier sections, change the connecting wire and grounding point in the power circuit.
   See Fig. below:

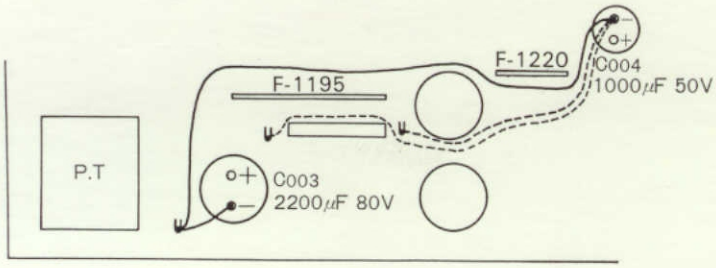

2. If Hum level is noticeable on PHONO 1 or 2 of the SELECTOR, insert the ripple filter between the equalizer amplifier "F-1253 (+B) and power circuit" F-1195 (5).
   See Fig. below:

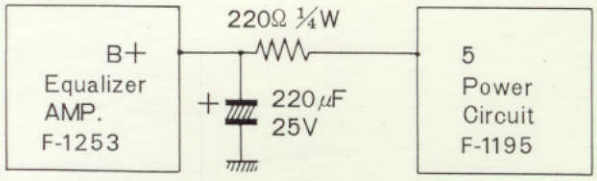

STOCK NO.	DISCRIPTION
0101221	220Ω ¼W
0513221	220μF 25V